## PRIORITY #1 FACILITIES PLAN

Town of Hillsdale Owner: Town Hall Facility Name:

COST TYPE
NEW - New Construction
ADD - Addition
ALT - Alterations
MSR - Major System Replacement

Note: Cost estimates do not include Haz. Mat. testing & abatement

Note: Cost estimates based on estimated



racility Name:	TOWN H	MSR - Major System Replacement   Note:   Cost estimated   REP - Repair   Cost of labor & materials in 2020										
Item#	Priority	y Description	Corrective Actions & Comments	Plan / Photo Key	Cost Type	Construction	5% Design	7% Escalation	10%	20%	PROBABLE BUDGET	
SITE FEATURES	1-5			, , , , , , , , , , , , , , , , , , , ,		Cost	Contingency		Contingency	Incidentals	ALLOCATION	
SITE TEATORES		Vegetation							1		1	
			Trees are against the building on the rear left side. These									
	1	Trees	trees need to be trimmed back away from the building to stop damage to the exterior.		MNT	\$ 2,500	\$ 12	5 \$ 175	\$ 250	\$ 610	\$ 3,660	
BUILDING STRU	CTURE						1			1		
		Roof										
	1	Plywood Sheathing	A small area on the underside of the plywood roof sheathing has mold from a roof leak. This should be cleaned or replaced.		REP	\$ 2,000	\$ 10	\$ 140	\$ 200	\$ 488	\$ 2,928	
	1	Patio & Column Restoration (Added by town)	Damaged area of front patio will be removed and replaced with an 8" thick reinforced concrete slab. The bottom blocking of the columns will be replaced with new wood		REP	\$ 10,000	\$ 50	\$ 700	\$ 1,000	\$ 2,440	\$ 14,640	
BUILDING												
ENVELOPE												
		Windows										
Alternate	1	Basement Windows	Replace (8) windows		MNT/REP	\$ 8,000	\$ 40	560	\$ 800	\$ 1,952	\$ 11,712	
	1	Window Wells	Remove wood 1x wells. Replace with masonry product		REP	\$ 750	\$ 3	3 \$ 53	\$ \$ 75	\$ 183	\$ 1,098	
		Roof and Skylights										
		ROOI and Skynghts										
	1	Gutters	Gutters are bent/falling at all sides of the roof. Replace all gutters with appropriately reinforced new gutters.		REP	\$ 1,300	\$ 6	\$ 91	. \$ 130	\$ 317	\$ 1,903	
	1	Flashing	Repair/replace bent flashing where roof meets wall in rear		REP	\$ 1,000	\$ 5	\$ 70	\$ 100	\$ 244	\$ 1,464	
	1	Roof Renovation	Fix all flashing, solder all seams, replace ridge, replace broken slate tiles		REP	\$ 24,705	\$ 1,235	\$ 1,729	\$ 2,471	\$ 6,028	\$ 36,168	
	1	New Gutter	Provide new gutter for rear entrance overhang		NEW	\$ 200	\$ 1	) \$ 14	\$ 20	\$ 49	\$ 293	
	1	New Leader extensions (Added by town)	Remove scuppers in front and provide new leaders to tie into existing downspouts.									
	1	New Snow Guards	Provide new snow guards at entire perimeter of roof		NEW	\$ 1,000	\$ 50	\$ 70	\$ 100	\$ 244	\$ 1,464	
Alternate	1	New Front Door (Added by town)	Provide new front door		REP	\$ 10,000	\$ 50	\$ 700	\$ 1,000	\$ 2,440	\$ 14,640	
BUILDING INTER	IOR											
		Floors										
	1	Basement Carpet	Replace carpet in basement		REP	\$ 11,000	\$ 55	\$ 770	\$ 1,100	\$ 2,684	\$ 16,104	
		Walls							1			
		1 Relocated door in basement	Relocate door at bottom of stair in basement to adjacent wall		ALT	10000	\$ 50	\$ 700	\$ 1,000	\$ 2,440	\$ 14,640	
		Ceilings										
		0-	Damage on ceiling is indicating potential water leaking									
	1	Upper Level Ceiling	issues from roof. Removed damaged sheetrock and patch in-kind (multiple locations).		REP	\$ 5,000	\$ 25	\$ 350	\$ 500	\$ 1,220	\$ 7,320	
		Attic										
			Replace all batt insulation. Existing insulation is covered		DED	ć 40 = 00		- 4		A 2500	45.000	
	1	Fiberglass Insulation	in mouse/rat droppings		REP	\$ 10,500	\$ 52	5 \$ 735	\$ 1,050	\$ 2,562	\$ 15,372	

1

Owner:	Town of	<u>Hillsdale</u>
Facility Name:	Town Hall	

COST TYPE

NEW - New Construction

ADD - Addition

ALT - Alterations

MSR - Major System Replace

Note: Cost estimates do not include Haz. Mat. testing & abatement



Facility Name:	Town Ha	<u>all</u>	MSR - Major System Replacement Note: Cost estimate REP - Repair cost of labor	s based on estimated & materials in 2020								Ľ	PLA	SINEERII NNING .team.c	
			ENG - Energy												
Item #	Priority 1-5	Description	Corrective Actions & Comments	Plan / Photo Key	Cost Type	Construction Cost		5% Design ontingency	7% Escalatio	n Cor	10% ntingency		20% identals		LE BUDGET CATION
	1	Subfloor	Areas of the plywood subfloor are covered in mouse/ droppings. This needs to be cleaned up.		MNT	\$ 5	00 \$	25	\$ 3	5 \$	50	\$	122	\$	732
	1	Access Cover	The cover has mouse/rat droppings all over it. Replac with a new cover and insulate the attic side to minimi energy loss		REP	\$ 3	00 \$	15	\$ 2	1 \$	30	\$	73	\$	439
HVAC SYSTEMS															
PLUMBING										1					
ELECTRICAL SYSTEMS	ı											1			
		Emergency or Standby Power System													
	1	None	Add emergency power for elevator at minimum		ADD	\$ 30,00	0 \$	1,500	\$ 2,10	0 \$	3,000	\$	7,320	\$	43,920
		Fire Alarm Systems													
	1	Need to add alarms asap	No fire panel, manual pull stations, smoke detectors, horns or strobes		ADD	\$ 25,00	0 \$	1,250	\$ 1,75	0 \$	2,500	\$	6,100	\$	36,600
		Carbon Monoxide Alarm System													
	1	Add sensors	Add/replace Sensors		ADD	\$ 50	00 \$	25	\$ 3	5 \$	50	\$	122	\$	732
		Communication Systems													
ENVIRONMENT															
INDOOR AIR		Air Analysis			1							1			
	1	NYS Article 32 Compliance	Based on results of the SanAir Report, Installation of a 2000 CFM commercial HEPA Air Scrubbers; commercial duct disinfection; HEPA vacuuming the floor, walls, ceiling, and contents, damp wipe the walls and ceiling with Decon 30 by hand, air polishing, let the machine run over the weekend, do clearance testing on a Monday. Same day results. Building open for business Tuesday.	al	REP	\$ 70,00	0 \$	3,500	\$ 4,90	0 \$	7,000	\$	17,080	\$	102,480
							1								
		TOTALS Revised 4/20/2023				\$ 224,2	55 \$	11,213	\$ 15,69	8 \$	<b>22,426</b> Front D		54,718 Iternate		<b>328,309</b> 14,640
		,, 10, 2020								Basem			Iternate		11,712
										То	tal Witho	out Alt	ernates	\$	301,957